Hand-held LCR Meter

LCR-914/915/916 Series

USER MANUAL

GW INSTEK PART NO. 82CR-91600MC1



ISO-9001 CERTIFIED MANUFACTURER



This manual contains proprietary information, which is protected by copyright. All rights are reserved. No part of this manual may be photocopied, reproduced or translated to another language without prior written consent of Good Will company.

The information in this manual was correct at the time of printing. However, Good Will continues to improve products and reserves the right to change specification, equipment, and maintenance procedures at any time without notice.

GUINSTEK LCR-914/915/916 User Manual



▲ Read First

▲ Safety Information

Understand and follow the operating instructions carefully. Use the meter only as specified in this manual; otherwise, the protection provided by the meter may be impaired.

Identifies hazardous conditions and actions that could cause **BODILY HARM** or **DEATH**.

Identifies conditions and actions that could **DAMAGE** the meter or equipment under test.

- When using test leads or probes, keep your fingers behind the finger guards.
- Remove test leads from the Meter before opening the battery door or the Meter case.
- Use the Meter only as specified in this manual or the protection by the Meter might be impaired.
- Always use the correct terminals, switch positions, and ranges for measurements.
- Do not apply more than the rated voltage, as marked on Meter, between terminals or between any terminal and earth ground.
- Use caution with voltages above 30 Vac rms, 42 Vac peak, or 60 Vdc. These voltages pose a shock hazard.
- To avoid false readings that can lead to electric shock and injury, replace the battery when the low battery indicator appears.
- Discharge all high-voltage capacitors before testing.
- · Do not use the Meter around explosive gas or vapor.
- To reduce the risk of fire or electric shock do not expose this product to rain or moisture.

- Never connect a source of voltage that could result in damage to the meter and the equipment under test.
- Do not expose the Meter to extremes in temperature or high humidity.

Symbols as Marked on the Meter and the Instruction Manual

À	Risk of electric shock
Â	See instruction manual
	DC measurement
ĒŦ	Battery
⇔	Fuse
Ŧ	Earth
~	AC measurement
CE	Conforms to EU directives
X	Do not discard this product or throw away.

Maintenance

Do not attempt to repair this Meter. It contains no user serviceable parts. Repair or servicing should only be performed by qualified personnel.


Cleaning

Periodically wipe the case with a dry cloth and detergent. Do not use abrasives or solvents.


Meter Description

Front Panel Illustration

- 1. LCD display: 20000/2000 counts.
- 2. Function buttons.
- 3. 5-Wire input terminal for SMD test probe or DIP part.
- 4. 2-Wire input terminal for Alligator Clips.

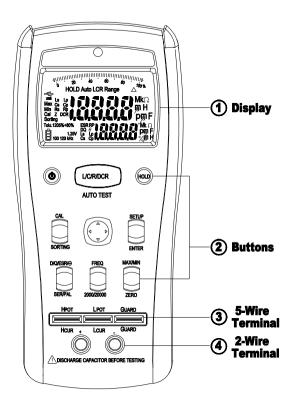


Package Contents

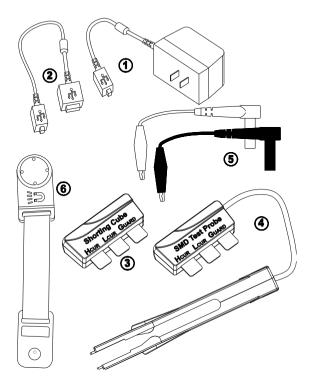

- 1. 5V AC Adapter (only LCR-916).
- 2. USB Cable (only LCR-916).
- 3. Shorting Cube.
- 4. SMD Test Probe (only LCR-916).
- 5. Alligator Clip Set.
- 6. Hanging Kit (only LCR-915/916).

Measuring Principles

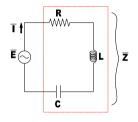

$$\overline{E} = R + j(X_{L} - X_{C})$$

$$\overline{Z} = \sqrt{R^{2} + (X_{L} - X_{C})} \leq tan^{-l} \left(\frac{X_{L} - X_{C}}{R}\right)$$

$$X_{L} = 2\pi f L = \omega L$$

$$X_{C} = \frac{1}{2\pi f C} = \frac{1}{\omega C}$$

$$\theta = tan^{-l} \left(\frac{X_{L} - X_{C}}{R}\right)$$


$$Q = \frac{1}{D} = tan\theta$$

Series Measurement





 $Z = R_s + jX_s$


Parallel Measurement

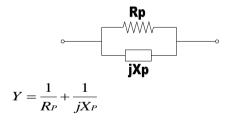

Phase Drawing

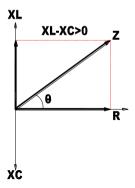


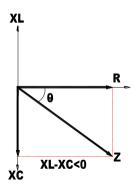

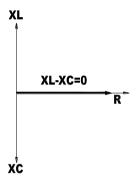


Making 5-Wire Measurements with the SMD

Test Probe

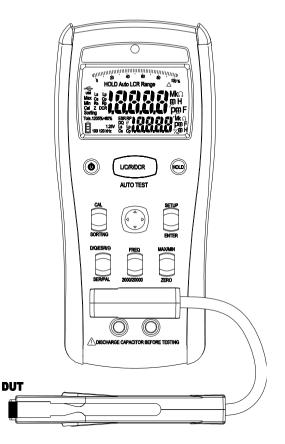


Making 4-Wire Measurements with the 5-Wire


Terminal

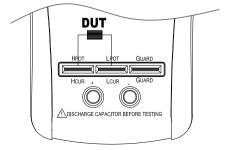

Making 2-Wire Measurements with the Alligator Clip Set

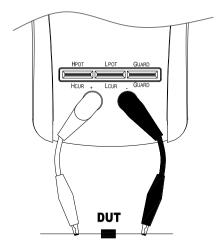


Measuring L/C/R/DCR

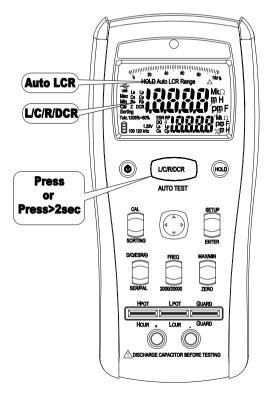


- \bullet Press the L/C/R/DCR button to select the measurement function.
- \bullet Press the L/C/R/DCR button for 2 seconds to enter the Auto L/C/R function.

Measuring D/Q/ESR/0

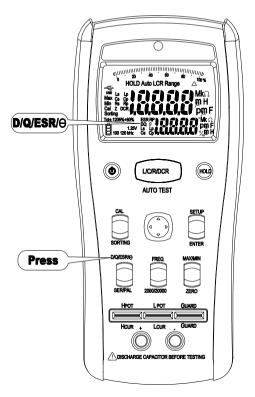

 \bullet Press the D/Q/ESR/ $\theta\,$ button to select the measurement function.


Selecting the Test Frequency

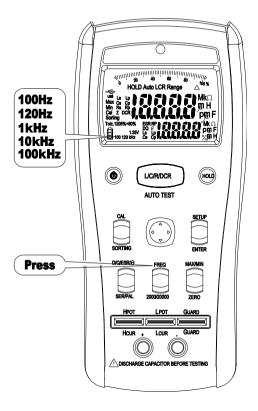

- Press the FREQ button to select the test frequency.
- The selectable frequency range depends on the model:
 - LCR-914: 100Hz, 120Hz, 1kHz. LCR-915: 100Hz, 120Hz, 1kHz, 10kHz. LCR-916: 100Hz, 120Hz, 1kHz, 10kHz, 100kHz.

Selecting the Series / Parallel Measurement

Function

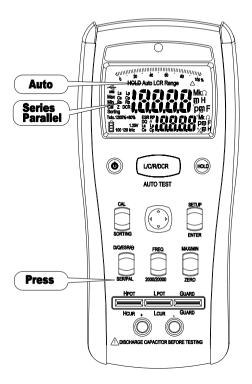

- At the L/C/R measuring function, it defaults to Auto Series / Parallel measuring function.
- Press the SER/PAL button to select the measuring function.

Selecting the Display Count






• Press the 2000 /20000 button to select the display count.

2000/20000


Zero

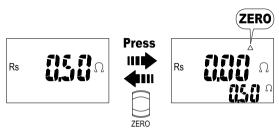

The Zero mode records the current input value as a reference and displays the reference on the sub display. Any inputs after this will be subtracted from the reference value and displayed on the main display. To use the Zero mode, follow the steps below.


- 1. Press the Zero button to enter Zero mode. The " Δ " symbol appears on the display.
- 2. Press the Zero button again to record a new input value as a reference.
- 3. Hold the Zero button for 2 seconds to exit this mode.

 Display Hold



• Press the HOLD button to hold the reading on the meter, press the button again to return.

Display MAX/MIN

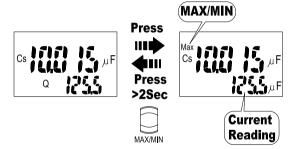


The MAX/MIN mode records the maximum and the minimum input values. When the inputs go below the recorded minimum value or above the recorded maximum value, the meter beeps and records the new value.

To use the MAX/MIN mode, follow the steps below:


- Press the MAX/MIN button to enter the MAX/MIN mode. The "MAX" icon appears on the display. The maximum value is shown on the main display and the current value is shown on the sub display.
- 2. Press the MAX/MIN button to select the MAX or MIN mode.
- 3. Press the MAX/MIN button for 2 seconds to exit this mode.

Note: This function is only for LCR-916.


Calibration

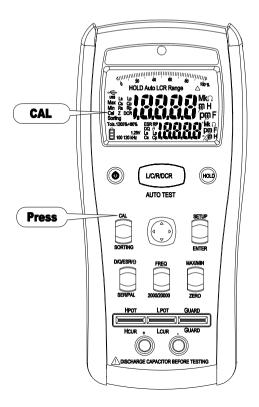

In order to achieve the best measurement results, calibration is essential. To calibrate the meter, press the CAL button.

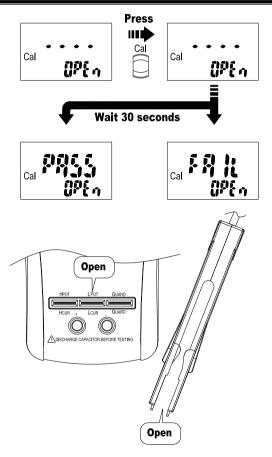


When "OPEn" appears on the sub display, make the terminal or the SMD test probe open, and press the CAL button to start the open calibration. About 30 seconds later, the result of the open calibration appears on the main display. If the result is "pass", press the CAL button to proceed to the next step. If the result is "fail", press the CAL button to exit the function. GUINSTEK LCR-914/915/916 User Manual

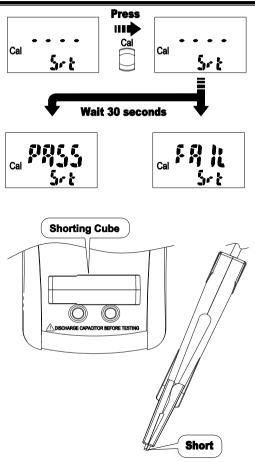


When "Srt" appears on the sub display, short the terminals or the SMD test probe, and then press the CAL button to start the short calibration. About 30 seconds later, the result of the short calibration appears on the main display. If the result is "pass", press the CAL button to complete the calibration. If the result is "fail", press the CAL button to exit the function.

Sorting

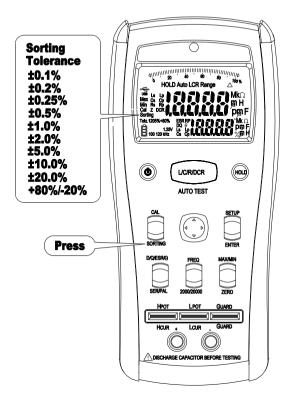


 To check the accuracy of a part, press the SORTING button to enter the sorting mode. The sorting result appears on the main display, and the current value appears on the sub display.



The default sorting standard value is the current value, and the default tolerance is $\pm 1.0\%$.

Setup Sorting Standard

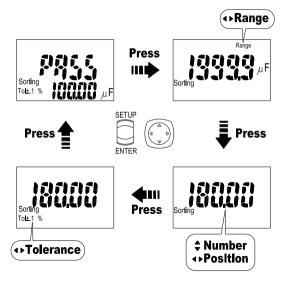


To setup the sorting standard value, follow the steps below:

- 1. Press the SETUP button to enter the setup mode.
- 2. Press ⊲ and ▷ button to setup the range of the standard value. Then press the ENTER button to save the setup value and enter the next step.
- 3. Press △, ▽, ⊲ and ▷ button to setup the standard value. Then press the ENTER button to save the setup value and enter the next step.
- 4. Press ⊲ and ▷ button to setup the tolerance value. Then press the ENTER button to save the setup value and exit this mode.

Battery Replacement

Refer to the following figure to replace the batteries :

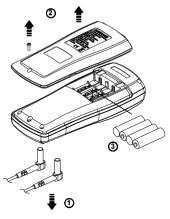


▲ Caution

- Replace the batteries as soon as the low battery indicator
 appears, to avoid false reading.
- 1.5V x 4 alkaline batteries.

External Power Source

Save battery power by using the external power source.

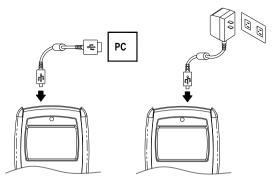

▲ Caution

- Use the 5V AC adapter only as specified in this manual.
- Do not use other power sources with the meter.

Specifications

General Specifications Maximum voltage applied to any terminal:

30V_{DC} or 30V_{AC} rms

Display: 2000/20000 counts

Overrange Indication: OL

Battery Life: 80 hours

Low Battery Indicator: " [] " is displayed when the battery

voltage drops below the operating voltage.

Low battery voltage: Approx. 4.5V

Auto Power Off: 10 minutes.

Operating Temperature: No-condensation $\leq 10^{\circ}$ C,

11°C ~ 30°C (≦80% RH), 30°C ~ 40°C (≦75% RH), 40°C ~ 50°C (≤45%RH)

Storage Temperature:

-20°C to 60°C, 0 to 80% R.H. (batteries not fitted)

Temperature Coefficient:

0.15 x (Spec.Accy) / °C, < 18°C or > 28°C.

Measurement: Samples 1.25 times per second normal.

Altitude: 6561.7 ft (2000m).

Weight: (630g) including battery.

Dimensions (W x H x D):

95mm x 207mm x 52mm with holster.

Accessories:

_				
	Accessory	LCR-916	LCR-915	LCR-914
1.	Shorting Cube	Standard	Standard	Standard
2.	2Wire Alligator Clip Set	Standard	Standard	Standard
3.	Magnetic Hang Kit	Standard	Standard	Optional
4.	Battery	Standard	Standard	Standard
5.	User Manual	Standard	Standard	Standard
6.	SMD Test Probe	Standard	Optional	Optional
7.	AC Adapter	Standard	Optional	Optional
8.	USB Cable	Standard	Optional	Optional
9.	PC Software CD	Standard	Optional	N/A
10.	4Wire DIP Clip Set	Optional	Optional	Optional

Power Requirements: 1.5V x 4 IEC LR6 or AA size. External Power Requirements: DC 5V (USB cable or AC adapter)

Pollution Degree: 2

Safety: Complies with EN 61010-1, IEC 61010-1 EMC: EN 61326-1

GUINSTEK LCR-914/915/916 User Manual

Shock Vibration: Sinusoidal vibration per MIL-T- 28800E (5 ~ 55 Hz, 3g maximum). Drop Protection: 4 feet drop to hardwood on concrete floor.

Electrical Specifications

(1) Test Frequency

Selectable Frequencies	Accuracy	
Ociectable i requeileles	Accuracy	
100 Hz	± 0.02%	
120 Hz	± 0.02%	
1 kHz	± 0.02%	
10 kHz ^[1]	± 0.02%	
100 kHz ^[2] ± 0.02%		
[1] The 10kHz test frequency is only for the LCR-915/916.		
[2] The 100kHz test frequency is only for the LCR-916.		

(2) Test Signal AC Signal Level: 600mVrms AC Signal Accuracy: ±10% DC Bias Level: 1V DC Bias Accuracy: ±10%

(3) Test Cable

Model	Length	Bandwidth	Туре
SMD Test Probe	60cm	1MHz	5-Wire
4-Wire Test Probe	60cm	1MHz	5-Wire
Alligator Clip Set	15cm	1kHz	2-Wire

Accuracy: ±(A x B)(% of reading) A: Basic Accuracy as specified by B: Test Cable Accuracy B(%) = 1 + (L x F x T) L(m): Cable length F(MHz): Test frequency T: Cable type. If the cable is 5-wire type, then "T" is 40, else "T" is 4,000.

When measuring by basic accuracy, the following conditions must be met:

- 1. Ambient temperature: 23°C ± 5°C < 80% RH.
- 2. Test cable length: 0m
- 3. Open and short calibration has been performed
- 4. $D \le 0.1$ for C, L measurements; $Q \le 0.1$ for R measurements.

See the operation manual for additional details.

(4) Inductance

Frequency	Range	Accuracy
	20.000mH	± (0.5% + 5d) ^[2]
	200.00mH	
100Hz	2000.0mH	· (0.29(· 2d)
120Hz	20.000H	± (0.2% + 2d)
IZUHZ	200.00H	
	2000.0H	$\pm (0.5\% + 2d)_{[4]}$ $\pm (1.0\% + 2d)^{[2][4]}$
	20.000kH	± (1.0% + 2d) ^{[2] [4]}
	2000.0uH	± (0.5% + 5d) ^[2]
	20.000mH	
	200.00mH	
1kHz	2000.0mH	± (0.2% + 2d)
	20.000H	
	200.00H	± (0.5% + 2d) [4]
	2000.0H	± (1.0% + 2d) ^{[2] [4]}
	200.00uH	± (0.5% + 5d) ^[2]
	2000.0uH	
10kHz ^[1]	20.000mH	± (0.2% + 2d)
TUKHZ	200.00mH	
	2000.0mH	± (2.0% + 2d)
	20.000H	± (5.0% + 2d)
	20.000uH	± (0.5% + 5d) ^[2]
100kHz ^[3]	200.00uH	
	2000.0uH	± (0.2% + 2d)
	20.000mH	± (2.0% + 2d)
	200.00mH	± (5.0% + 2d)
[1] The 10kHz test frequency is only for the LCR-915/916.		

[2] The measuring time is 2 seconds.[3] The 100kHz test frequency is only for the LCR-916.

[4] When using the external power, the accuracy is unspecified

Input Protection: 30V_{DC} or 30V_{AC} rms Minimum Resolution: 0.001uH in the 20.000uH range. Measuring Time: 800ms

Note: If D > 0.1, the accuracy should be multiplied by $\sqrt{1+D^2}$

(5) Capacitance

Frequency	Range	Accuracy	
	2000.0pF	± (0.5% + 5d) ^{[2][4]}	
	20.000nF [4]		
	200.00nF		
100Hz	2000.0nF	± (0.2% + 2d)	
120Hz	20.000uF		
	200.00uF	± (0.5% + 2d)	
	2000.0uF	± (1.0% + 2d)	
	20.000mF	$\pm (2.0\% + 2d)^{[2]}$	
	2000.0pF	± (0.5% + 5d) ^{[2][4]}	
	20.000nF [4]		
	200.00nF	± (0.2% + 2d)	
1kHz	2000.0nF		
	20.000uF	± (0.5% + 2d)	
	200.00uF	± (1.0% + 2d)	
	2000.0uF	± (2.0% + 2d) ^[2]	
	200.00pF	± (0.5% + 5d) ^[2]	
	2000.0pF		
	20.000nF	± (0.2% + 2d)	
10kHz ^[1]	200.00nF	± (0.2 % + 20)	
	2000.0nF		
	20.000uF	± (2.0% + 2d)	
	200.00uF	± (5.0% + 2d) ^[2]	
	20.000pF	± (0.5% + 20d) ^[2]	
	200.00pF		
100kHz ^[3]	2000.0pF	± (0.2% + 2d)	
	20.000nF	± (0.2 % + 20)	
	200.00nF		
	2000.0nF	± (2.0% + 2d)	
	20.000uF	± (5.0% + 2d) ^[2]	
[1] The 10kHz test frequency is only for the LCR-915/916.			
[2] The measuring time is 2 seconds.			
[3] The 100kHz test frequency is only for the LCR-916.			

[4] When using the external power, the accuracy is unspecified.

Input Protection: $30V_{\infty}$ or $30V_{AC}$ rms Minimum Resolution: 0.001pF in the 20.000pF range. Measuring Time: 800ms

Note: If D > 0.1, the accuracy should be multiplied by $\sqrt{1+D^2}$

(6) Resistance

Frequency	Range	Accuracy	
10011-	200.00Ω	± (0.2% + 5d)	
	2.0000kΩ		
	20.000kΩ	± (0.2% + 2d)	
100Hz 120Hz	200.00kΩ	$\pm (0.2\% + 20)$	
12002	2.0000MΩ		
	20.000MΩ	± (0.5% + 2d) [4]	
	200.00MΩ	± (1.0% + 2d) ^{[2][4]}	
	20.000Ω	± (0.5% + 5d) ^[2]	
	200.00Ω		
	2.0000kΩ		
1kHz	20.000kΩ	± (0.2% + 2d)	
IKEZ	200.00kΩ		
	2.0000MΩ		
	20.000MΩ	± (2.0% + 2d) [4]	
	200.00MΩ	$\pm (5.0\% + 2d)^{[2][4]}$	
	20.000Ω	± (0.5% + 5d) ^[2]	
	200.00Ω		
	2.0000kΩ	· (0.2% · 2d)	
10kHz ^[1]	20.000kΩ	± (0.2% + 2d)	
	200.00kΩ		
	2.0000MΩ	± (2.0% + 2d)	
	20.000MΩ	± (5.0% + 2d)	
	20.000Ω	± (0.5% + 5d) ^[2]	
100kHz ^[3]	200.00Ω		
	2.0000kΩ	± (0.2% + 2d)	
	20.000kΩ		
	200.00kΩ	± (2.0% + 2d)	
	2.0000ΜΩ	± (5.0% + 2d)	
[1] The 10kHz test frequency is only for the LCR-915/916.			
[2] The measuring time is 2 seconds.			
[3] The 100kHz test frequency is only for the LCR-916			

[3] The 100kHz test frequency is only for the LCR-916.

[4] When using the external power, the accuracy is unspecified.

Input Protection: $30V_{\text{\tiny DC}}$ or $30V_{\text{\tiny AC}}$ rms Minimum Resolution: 0.001Ω in the 20.000Ω range. Measuring Time: 800ms

Note: If Q > 0.1, the accuracy should be multiplied by $\sqrt{1+Q^2}$

(7) DCR

Range	Resolution	Accuracy
200.00Ω	0.01Ω	± (0.2% + 5d)
2.0000kΩ	0.0001kΩ	
20.000kΩ	0.001kΩ	. (0.2% + 2d)
200.00kΩ	0.01kΩ	<u>+</u> (0.2% + 2d)
2.0000MΩ	0.0001MΩ	
20.000MΩ	0.001MΩ	± (0.5% + 2d) [2]
200.00MΩ	0.01MΩ	± (1.0% + 2d) [1][2]
[1] < 50dgt rolling.[2] When using the external power, the accuracy is unspecified.		

Input Protection: $30V_{DC}$ or $30V_{AC}$ rms **Minimum Resolution:** 0.01Ω in the 200.00Ω range. **Measuring Time:** 2 seconds

(8) D & Q Definition Q=1/D Range: 2.000 ~ 2000 Minimum Resolution: 0.001 in the 2.000 range. Accuracy: Accuracy of Main Reading x (1+D) Input Protection: $30V_{ac}$ or $30V_{ac}$ rms Note: When equipped with the external power the accuracy is unspecified.

(9) ESR

The specification for ESR is the same as Resistance.

(10) θ

Range	Resolution	Accuracy
-90.0° ~ 90.0°	0.1°	± (0.2% + 5d)

Input Protection: $30V_{\text{\tiny DC}}$ or $30V_{\text{\tiny AC}}$ rms

Note: When equipped with the external power the accuracy is unspecified.